

HYUNDAI/VELOSTER D6GF1**NO ENGAGEMENTS**

COMPLAINT: A 2012 Veloster equipped with a D6GF1 (Dual Clutch) was brought into the shop with a complaint of no movement forward or reverse. The technician was going to replace the clutch assembly but found the price from the dealer was \$6000.00 so they decided to purchase a used transmission instead. After installing the used transmission, they still had no engagements. He was unable to perform a clutch relearn and decided to check for codes. The only current code was P0108 for the map sensor. After replacing the sensor and clearing the code he was able to complete the clutch relearn procedure and corrected the complaint.

CAUSE: The P0108 was not allowing the clutch relearn to be completed.

CORRECTION: Replace map sensor (figure 1).

Many thanks to David from Transmission Masters-Berleson for sharing his experience with ATSG.



Copyright © ATSG 2026

Figure 1